

Work Order ID 85158

85158

Page 1

June-04-12 10:21:05 AM

Item ID: D3391-023

Accept

N900040100

Setup Start ***NS1***

Revision ID:

Stop ***NS2***

Item Name: Mid Tube Assembly

Start Date: 04/06/2012 Start Qty: 1.00

1

Cust Item ID:

Required Date: 18/06/2012 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals:

Process Plan: MLJ

Date: 12/06/04 Tooling:

Date:

Run Start ***NR1***

QC:

Date: SPC (Y/N):

Date:

Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

Draw Nbr

Revision Nbr

D3391

I

100

0.00

100

Skidtubes

Skidtubes

Skidtubes

Memo

0.00

1-Cut tube to finish length as per Dwg D3391 ✓

2-Drill pilot holes using DT8796 (Do not drill "B" holes) and drill only 1 fwd saddle hole on one side only as per Dwg D3391 ✓

3-Open saddles and GHW holes to Ø0.375" except for fwd saddle hole of detail "J" ✓

4-Remove .030" from Fwd indexing Ridge as per Dwg D3391 ✓

5-Remove indexing ridge on Fwd & Aft end of skidtube as per Dwg D3391 ✓

6-Deburr ✓

7-Drill #30 pilot holes using wearplate Jig DT8217 Identify Ø0.250" holes with paint marker, ✓

***DO NOT DRILL HOLES #3-19-20 FROM FWD END OF JIG

8-Open wearplate holes of D3391-023 assembly detail section G-G to Ø0.250" (10 holes) as per Dwg D3391 ✓

9-Open wearplate holes of D3391-023 assembly detail section H-H to Ø0.297" (20 holes) as per Dwg D3391 ✓

DO NOT OPEN 2 MOST FWD WEARPLATE HOLES

SAD 12-06-04

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Work Order ID 85158

85158

Page 2

June-04-12 10:21:05 AM

Item ID: D3391-023

Accept

N900040100

Setup Start ***NS1***

Revision ID:

Stop ***NS2***

Item Name: Mid Tube Assembly

Start Date: 04/06/2012 Start Qty: 1.00

1

Cust Item ID:

Required Date: 18/06/2012 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals: Process Plan: Date: Tooling: Date:

Run Start ***NR1***

QC: Date: SPC (Y/N): Date:

Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
	10-Open .375" holes to .438" ***do not open fwd saddle holes***		SAD	12-06-09					
	11-Locate D3391-021 in D3391-023 at 9.00" (see view z-z)								
	12- Transfer drill one fwd saddle hole only to .188" dia, transfer drill all remaining fwd saddle holes using DT 8149 locating from previously drill .188" dia hole, using t-pins and clicos to ensure perfect allingment, open up previously tranfer drilled pilot holes in D3391-023/-021 to 0.438" dia. in D3391-021								
	13- Using DT8217, locating from two previously drilled holes, drill remaining wearplate holes into D3391-021.								
	14- Locating from two fwd wearplate holes in D3391-023 drill remaining 6 wearplte holes in D3391-021 using DT8937								
	15- Open 12 wearplate holes in D3391-021 to 0.297" dia.								
	16-Deburr and blow out all chips from inside tube, scribe batch # in D3391-023 at aft end.								

DC 12/06/05

110

QC5- Inspect part completeness to step on W/O

0.00

110

QC

Memo

0.00

Quality Control

Sadlos

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Work Order ID 85158***85158***

Page 3

June-04-12 10:21:05 AM

Item ID: D3391-023

Accept

N900040100Setup Start ***NS1***

Revision ID:

Stop ***NS2***

Item Name: Mid Tube Assembly

Start Date: 04/06/2012 Start Qty: 1.00

1

Cust Item ID:

Required Date: 18/06/2012 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals:

Process Plan:

Date:

Tooling:

Date:

Run Start ***NR1***

QC:

Date:

SPC (Y/N):

Date:

Stop ***NR2***Sequence ID/
Work Center IDOperation
DescriptionSet Up/
Run HoursTool ID Tool # Plan
CodeAccept Reject Reject Insp.
Qty Qty Number Stamp

120

Chemical Conversion Coat per QSI005 4.1

0.00

120

HandFinish

Memo

0.00

Hand Finishing

① SAD 12.06.06

130

QC7-Inspect Chemical Conversion Coat

0.00

130

QC

Memo

0.00

Quality Control

① P/D 12/06/06

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Work Order ID 85158***85158***

Page 4

June-04-12 10:21:05 AM

Item ID: D3391-023

Accept

N900040100Setup Start ***NS1***

Revision ID:

Stop ***NS2***

Item Name: Mid Tube Assembly

Start Date: 04/06/2012 Start Qty: 1.00

1

Cust Item ID:

Required Date: 18/06/2012 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals:

Process Plan:

Date:

Tooling:

Date:

Run Start ***NR1***

QC:

Date:

SPC (Y/N):

Date:

Stop ***NR2***Sequence ID/
Work Center IDOperation
DescriptionSet Up/
Run Hours

Tool ID

Tool #

Plan
CodeAccept
QtyReject
QtyReject
NumberInsp.
Stamp

140

0.00

140

Skidtubes

Skidtubes

Memo

0.00

1-Open float bag holes as per dwg
2-C'sink float bag holes as per dwg
3- Prepare tube for welding
4-Bond web in place as per Dwg D3391 & QSI 015.
Adhere for 12 hours)
A/R Sikaflex exp: 13-4-12
batch#: M121409

NOTE:ENSURE WEB IS INSERTED IN AFT END OF TUBE

1 Ø CF126-6

150

QC5- Inspect part completeness to step on W/O

0.00

150

QC

Memo

0.00

Quality Control

1 Ø BE 12/06/07

Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ **PAR #:** _____ **Fault Category:** _____ **NCR: Yes No** **DQA:** _____ **Date:** _____
Resolution: _____ **Disposition:** _____ **QA: N/C Closed:** _____ **Date:** _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Work Order ID 85158***85158***

Page 5

June-04-12 10:21:05 AM

Item ID: D3391-023

Accept

N900040100Setup Start ***NS1***

Revision ID:

Stop ***NS2***

Item Name: Mid Tube Assembly

Start Date: 04/06/2012 Start Qty: 1.00

1

Cust Item ID:

Required Date: 18/06/2012 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run Start ***NR1***

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

160

0.00

160

Skidtubes

0.00

Skidtubes

Memo

Skidtubes

1-Weld crossbolt spacer as per dwg D3391 & QSI 004
2-grind weld flush

A/R 120854

- Dec 12/06/07

1 8 BE 12/06/07

170

0.00

170

QC10- Inspect visual per QSI004- ground welds

0.00

QC

Memo

Quality Control

Suzuki

180

0.00

180

QC5- Inspect part completeness to step on W/O

0.00

QC

Memo

Quality Control

Suzuki

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Work Order ID 85158

85158

Page 6

June-04-12 10:21:05 AM

Item ID: D3391-023
Revision ID:
Item Name: Mid Tube Assembly

Accept

N900040100

Setup Start ***NS1***

Stop ***NS2***

Start Date: 04/06/2012 Start Qty: 1.00 ***1***
Required Date: 18/06/2012 Req'd Qty: 1.00 ***1***

Cust Item ID:
Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____
QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Run Start ***NR1***
Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

185 Pressure Wash per QSI005 4.3

0.00

185

HandFinish

Memo

0.00

Hand Finishing

AND REALODINE AS PER PAR09-043

1 *MG* 126-7

190

White Gloss(Ref:4.3.5.1) per QSI005 4.3-Alum

0.00

190

Powdercoat

Powder Coating

Memo

START TIME:

OVEN TEMPERATURE:

FINISH TIME:

0.00

200

QC3- Inspect Part Finish

0.00

200

QC

Quality Control

Memo

0.00

m-f
1X *✓* 12/06/07

M. 21134

2:20
3200 F
2:50

1X *d* *HL* 12/06/11

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Work Order ID 85158

85158

Page 8

June-04-12 10:21:05 AM

Item ID: D3391-023
Revision ID:
Item Name: Mid Tube Assembly

Accept

N900040100

Setup Start ***NS1***

Stop ***NS2***

Start Date: 04/06/2012 Start Qty: 1.00 ***1***
Required Date: 18/06/2012 Req'd Qty: 1.00 ***1***

Cust Item ID:
Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____
QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Run Start ***NR1***

Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
230	HandFinishing	0.00							
230									
HandFinish	Memo	0.00							
Hand Finishing	Install Inserts as per Dwg								
240	QC5- Inspect part completeness to step on W/O	0.00							
240									
QC	Memo	0.00							
Quality Control									
250	Identify as per dwg & Stock Location: <u>w/o</u>	0.00							
250									
Packaging	Memo	0.00							
Packaging									

1x f Hl uloc 11

8/20/14

D 412 - 742-043 / 1385247

1x f Hl uloc 11

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Work Order ID 85158***85158***

Page 9

June-04-12 10:21:05 AM

Item ID: D3391-023

Accept

N900040100Setup Start ***NS1***

Revision ID:

Stop ***NS2***

Item Name: Mid Tube Assembly

Start Date: 04/06/2012 Start Qty: 1.00

1

Cust Item ID:

Required Date: 18/06/2012 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run Start ***NR1***

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
260	QC21- Final Inspection - Work Order Release	0.00							
260									
QC	Memo	0.00							
Quality Control									

12/6/12

MF
12-06-11

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Picklist Print

June-04-12 10:21:09 AM

Page 1

Work Order ID: 85158

85158

Parent Item: D3391-023

D3391-023

Parent Item Name: Mid Tube Assembly

Start Date: 04/06/2012

Required Date: 18/06/2012

Start Qty: 1.00

Required Qty: 1.00

Comments:

IPP A05.10.20 New Issue KJ/EC
 IPP B06.02.10 ECN 773 dwg rev.D EC
 IPP C 07.03.20 rev F dwg EC
 IPP D 07.03.28 re-format EC
 IPP E 07.10.31 ecn 1053P EC
 IPP Rev:F ECN 1056 07-11-13 DD verified by: EC
 IPP Rev:G 08-09-08 new process (ecn 08-510) DD verified by:EC
 IPP Rev:H 08-09-10 revH as per dwg DD verified by:EC
 IPP Rev:I 08-11-13 Removed steps per w/o, QC KJ verified by: ec IPP
 Rev:J add in seq 140 expire date & b# sikaflex DD 10.02.17 verified by:EC

Component Item ID/ Item Name	Replacement Item ID	Mfg/ Purch	Bin Item	Primary Location	Last Location	Route Seq ID	Unit of Measure	Qty on Hand	Qty per Kit	Total Qty	Qty Issued	Date Issued	Status
D2500-1-100 *D2500-1-100* Skidtube Extrusion		Manufactured	No			100	Each	82.0000	1	1		12-06-04	**
				<u>Location</u>				<u>Loc Qty</u>					
				HALL				82					
				50251				9					
				82373				73					
D3391-021 *D3391-021* Fwd Tube Assembly		Manufactured	No			100	Each	0.0000	1	1		12/06/04	**
D3389-1 *D3389-1* Web		Manufactured	No			140	Each	10.0000	1	1		12-66	**
				<u>Location</u>				<u>Loc Qty</u>					
				LG				10					
				83848				4					
				83849				6					

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Picklist Print

June-04-12 10:21:09 AM

Page 2

Work Order ID: 85158

85158

Parent Item: D3391-023

D3391-023

Parent Item Name: Mid Tube Assembly

Start Date: 04/06/2012

Required Date: 18/06/2012

Start Qty: 1.00

Required Qty: 1.00

D3681-1

Manufactured No

160

Each

87.0000

5

5

D3681-1

Spacer

DE 12/06/07

Location

Loc Qty

Loc Code

LG

77

80361

1

84053

76

5

LG001

10

68958

2

69893

2

71845

2

74874

1

76004

1

77501

2

D3591-1

Manufactured No

210

Each

96.0000

2

2

D3591-1

Bushing

21 n1061 u

Location

Loc Qty

Loc Code

FP

5

80377

4

82027

1

ST055

91

57350

1

83237

90

x 2

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Picklist Print

June-04-12 10:21:09 AM

Page 3

Work Order ID: 85158

85158

Parent Item: D3391-023

D3391-023

Parent Item Name: Mid Tube Assembly

Start Date: 04/06/2012

Required Date: 18/06/2012

Start Qty: 1.00

Required Qty: 1.00

ALS4-1032-130

Purchased

No

230

Each

2,457.000

20

20

AI S4-1032-130

**

yl 12/06/12

Insert

Location

Loc Qty

Loc Code

ST280

205

119084

116

120671

89

ST281

74

120807

36

120837

38

ST282

2178

121269

2178

yl 12/06/12


W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

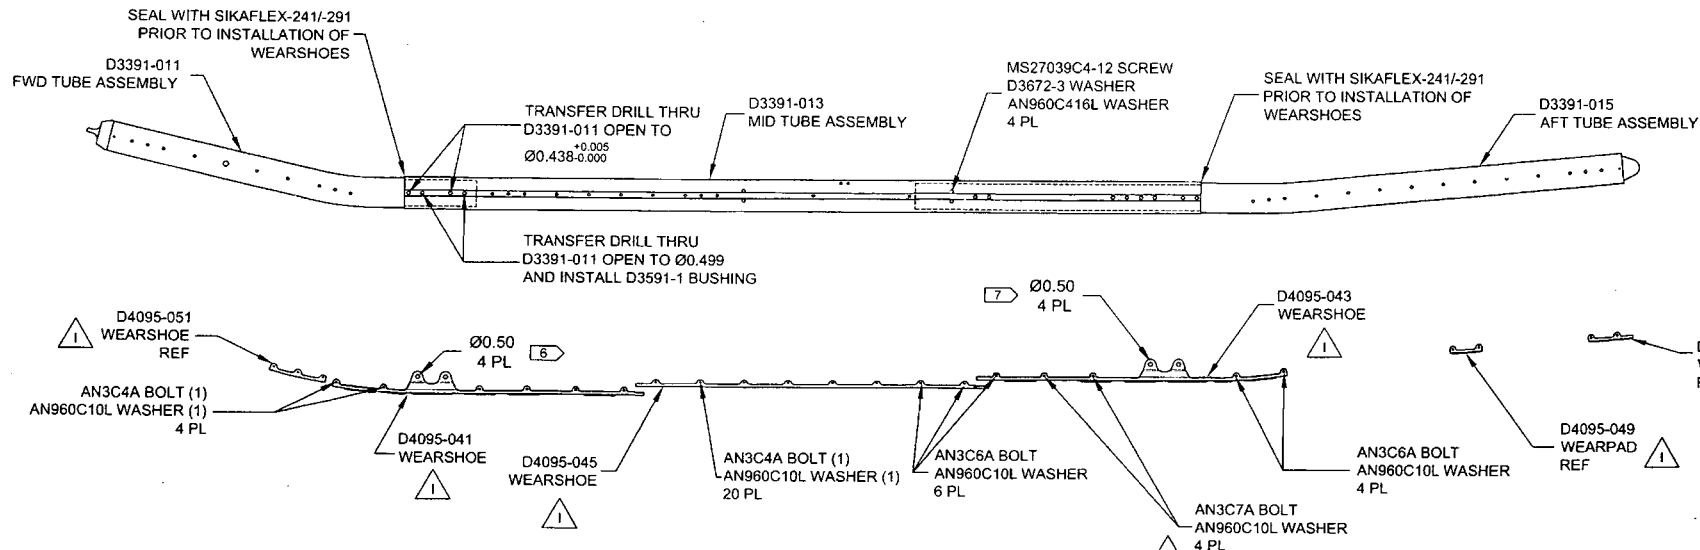

D3391-041 FLOAT SKIDTUBE ASSEMBLY PARTS LIST

QTY -041	PART NUMBER	DESCRIPTION
X	D3391-041	FLOAT SKIDTUBE ASSEMBLY
1	D3391-011	FWD TUBE ASSEMBLY
1	D3391-013	MID TUBE ASSEMBLY
1	D3391-015	AFT TUBE ASSEMBLY
2	D3591-1	BUSHING
4	D3672-3	WASHER
1	D4095-041	WEARSHOE
1	D4095-043	WEARSHOE
1	D4095-045	WEARSHOE
1	D4095-047	WEARSHOE
1	D4095-049	WEARSHOE
1	D4095-051	WEARSHOE
24	AN3C4A	BOLT
10	AN3C6A	BOLT
4	AN3C7A	BOLT
38	AN960C10L	WASHER
4	MS27039C4-12	SCREW
4	AN960C416L	WASHER

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER

NO. **85158 MWJ**

GENERAL NOTES

- 1) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
POWDER COAT WHITE (4.3.5.1) PER DART QSI 005 4.3
- 2) COAT ALL EXPOSED FASTENERS WITH LPS LABORATORIES "LPS PROCYON"
AFTER FINAL ASSEMBLY, CLEAN EXCESS OFF POWDER COATING WITH MEK DEGREASER.
- 3) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED
- 5) USE DART DRILL TEMPLATE DT8217 TO LOCATE AND DRILL Ø0.297 SIZE HOLES
FOR WEARSHOE INSERTS. C'BORE AS NOTED AND INSTALL INSERTS EXCEPT
WHERE INDICATED.
- 6) FIT D4095-041 TO SKIDTUBE WITH D2571 AND D2572 SADDLES INSTALLED WITH
APPROPRIATE HARDWARE AND SPACERS IN FORWARD AND AFT HOLES AND
TRANSFER DRILL Ø0.50 HOLES FROM SADDLE TO D4095-041
- 7) FIT D4095-043 TO SKIDTUBE WITH D2571 AND D2572 SADDLES INSTALLED WITH
THE APPROPRIATE HARDWARE AND SPACERS IN FORWARD AND AFT HOLES AND
TRANSFER DRILL Ø0.50 HOLES FROM SADDLE TO D4095-043

RELEASED
2011-11-04
ECN#11-662

I	REMOVE GASKETS AND REPLACE ALL WEARSHOES; PARTS LIST UPDATE, ZN A8-1, ZN A8-2, ZN A6-4, ZN B6-8; LPS-3 COATING REMOVED FROM NOTE 2, ZN A3-1, ZN A3-2, REMOVED INSERT AELS-1032-130, ZN B6-4, B2-4, C7-8, C3-8; REMOVED HOLES, ZN D6-4 ZN D2-4, ZN D7-8, ZN D3-8	XDF	11.10.13
H	DRAWING UPDATED TO CURRENT STANDARDS. SHT 1 PL ADDED D3591-1 BUSHING, ZN C6 Ø0.438 DIM WAS 4 PL. ADDED Ø0.499 DIM AND D3591-1 BUSHING. SHT 2 PL ADDED D3591-1 BUSHING, ZN C6 Ø0.438 DIM WAS 4 PL. ADDED Ø0.499 DIM AND D3591-1 BUSHING. (FOR FURTHER INFO SEE DSI 9364 & NCR 08-074)	AJS	08.08.20
G	REPLACE NAS INSERTS W/ AELS INSERTS SWITCH TO D3670-XXXX SPACERS FOR INSTALLING FLOAT BAGS, DWG REORGANIZED FOR CLARITY	DC	07.07.31
F	ADD SS WEARSHOE, GASKET REMOVE FWD SADDLE HOLE -011/-021	PH	07.01.18
E	CHANGE TOLERANCE, EASE MANUFACTURE	PH	06.04.25
D	UPDATE TOLERANCE, CHANGE HOLE SIZE	PH	06.01.23
C	LENGTHEN AFT EXTENSION	PH	05.09.27
B	DRAWING UPDATES	PH	05.06.10
A	NEW ISSUE	PH	05.02.07
REV.	DESCRIPTION	BY	DATE
DESIGN	PH	DART AEROSPACE USA, INC	
DRAWN	XDF	KENT, WA	
CHECKED		DRAWING NO.	REV. 1
MFG. APPR.		D3391	SHEET 1 OF 8
APPROVED		TITLE	SCALE
DE APPR.		412 FLOAT SKIDTUBE	NTS
DATE	11.10.13	COPYRIGHT © 2005 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector


Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

25158

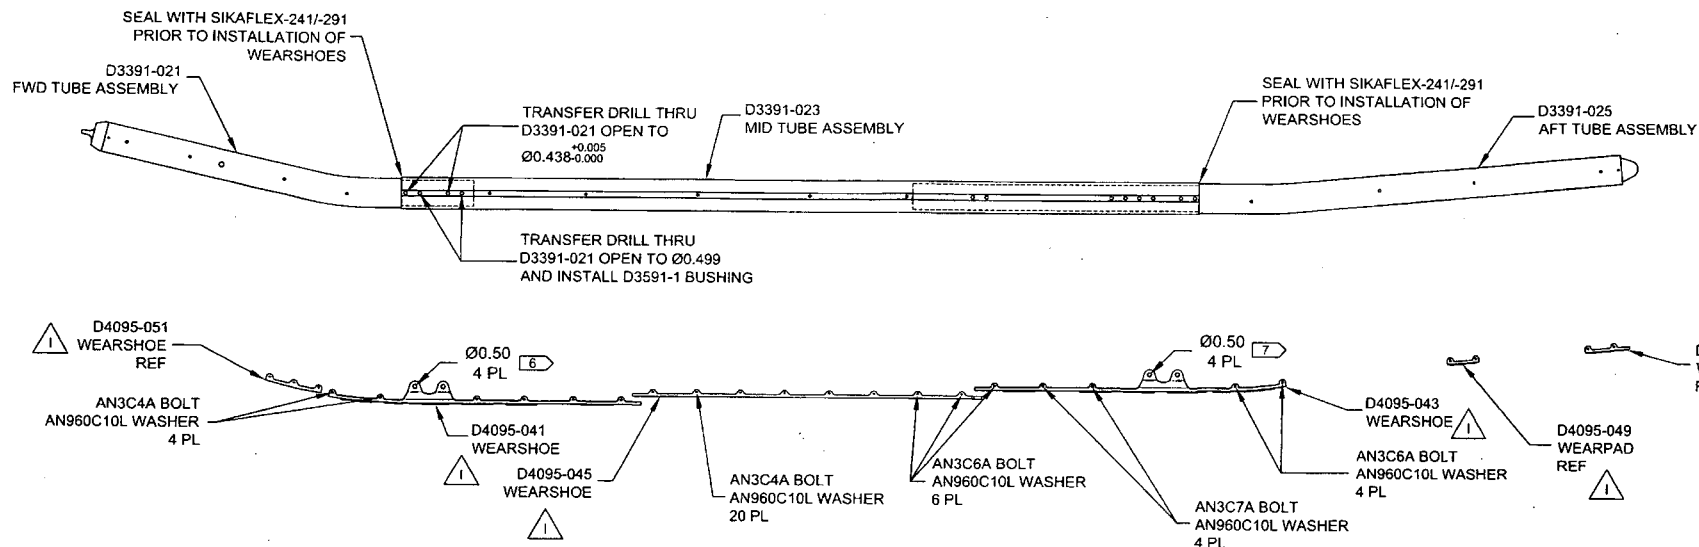

D3391-043 ASSEMBLY

D3391-043 FLOAT SKIDTUBE ASSEMBLY PARTS LIST

QTY	PART NUMBER	DESCRIPTION
X	D3391-043	FLOAT SKIDTUBE ASSEMBLY
1	D3391-021	FWD TUBE ASSEMBLY
1	D3391-023	MID TUBE ASSEMBLY
1	D3391-025	AFT TUBE ASSEMBLY
2	D3591-1	BUSHING
1	D4095-041	WEARSHOE
1	D4095-043	WEARSHOE
1	D4095-045	WEARSHOE
1	D4095-047	WEARSHOE
1	D4095-049	WEARPAD
1	D4095-051	WEARPAD
24	AN3C4A	BOLT
10	AN3C6A	BOLT
4	AN3C7A	BOLT
38	AN960C10L	WASHER

GENERAL NOTES

- 1) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
POWDER COAT WHITE (4.3.5.1) PER DART QSI 005 4.3
- 2) COAT ALL EXPOSED FASTENERS WITH LPS LABORATORIES "LPS PROCYON"
- 3) AFTER FINAL ASSEMBLY, CLEAN EXCESS OFF POWDER COATING WITH MEK DEGREASER.
- 4) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
- 5) UNITS: INCHES UNLESS OTHERWISE NOTED
- 6) USE DART DRILL TEMPLATE DT8217 TO LOCATE AND DRILL Ø0.297 SIZE HOLES FOR WEARSHOE INSERTS. C'BORE AS NOTED AND INSTALL INSERTS EXCEPT WHERE INDICATED.
- 7) FIT D4095-041 TO SKIDTUBE WITH D2571 AND D2572 SADDLES INSTALLED WITH APPROPRIATE HARDWARE AND SPACERS IN FORWARD AND AFT HOLES AND TRANSFER DRILL Ø0.50 HOLES FROM SADDLE TO D4095-041
FIT D4095-043 TO SKIDTUBE WITH D2571 AND D2572 SADDLES INSTALLED WITH THE APPROPRIATE HARDWARE AND SPACERS IN FORWARD AND AFT HOLES AND TRANSFER DRILL Ø0.50 HOLES FROM SADDLE TO D4095-043

RELEASED
2011-11-04

DESIGN	PH	DART AEROSPACE USA, INC	
DRAWN	XDF	KENT, WA	
CHECKED		DRAWING NO.	REV. 1
MFG. APPR.		D3391	SHEET 2 OF 8
APPROVED		TITLE	SCALE
DE APPR.		412 FLOAT SKIDTUBE	NTS
DATE	11.10.13	<small>COPYRIGHT © 2005 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS UNDERSTANDING THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.</small>	


W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____


Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			


NOTE: Date & initial all entries

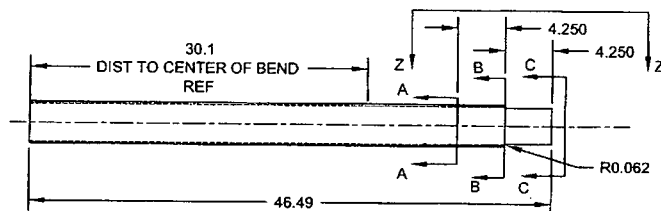


D3391-1 CUTTING DETAIL
(MAKE FROM D6013-047 SKIDTUBE MATERIAL)

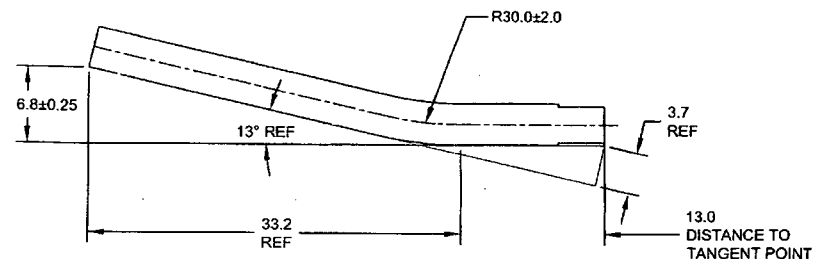


D3391-011/-021 BENDING DETAIL
(MAKE FROM D3391-1)

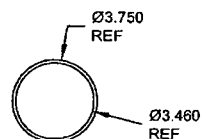


SECTION A-A
SCALE 2X

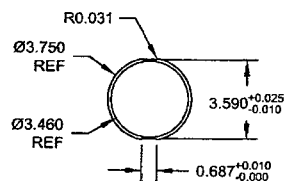

SECTION B-B
SCALE 2X

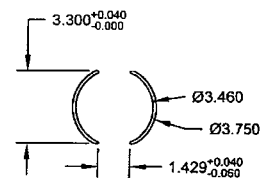

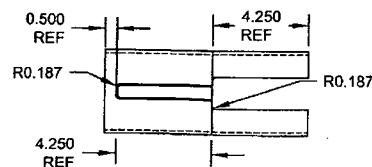

SECTION C-C
SCALE 2X



VIEW Z-Z
SCALE 2X

RELEASED
2011-11-04

DESIGN	PH	DART AEROSPACE USA, INC	
DRAWN	XDF	KENT, WA	
CHECKED		DRAWING NO.	REV.
MFG. APPR.		D3391	SHEET 3 OF 8
APPROVED		TITLE	SCALE
DE APPR.		412 FLOAT SKIDTUBE	NT
DATE	11.10.13	COPYRIGHT © 2005 BY DART AEROSPACE USA, INC	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.			

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector


Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____


NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries


25758

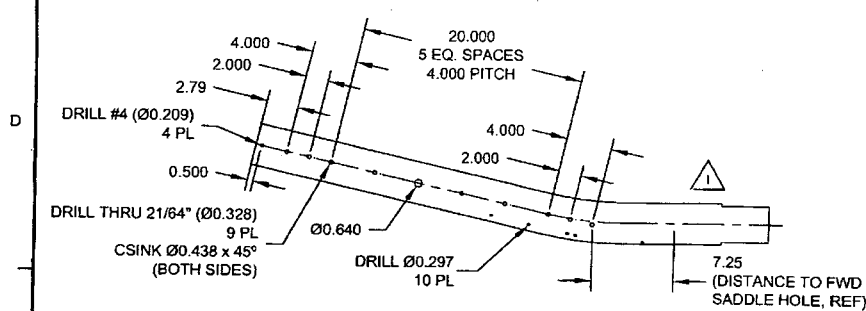


D3391-011 DRILLING DETAIL

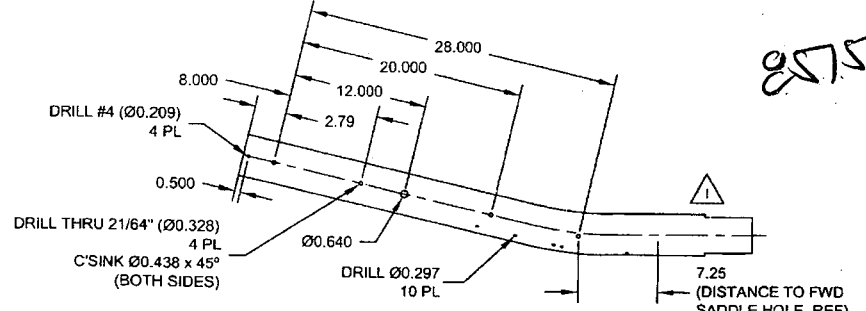

D3391-021 DRILLING DETAIL

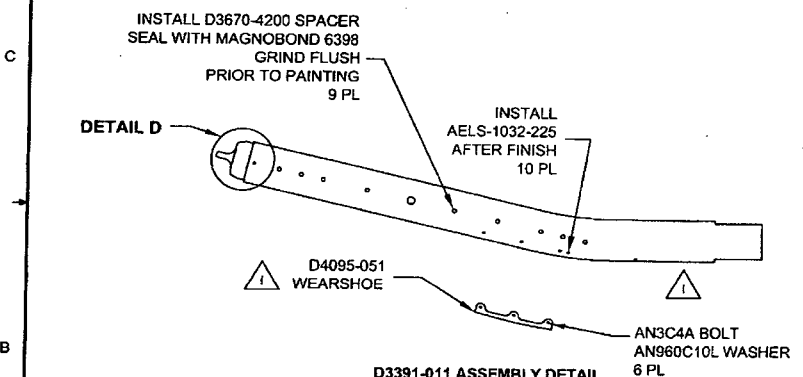


D3391-011 ASSEMBLY DETAIL

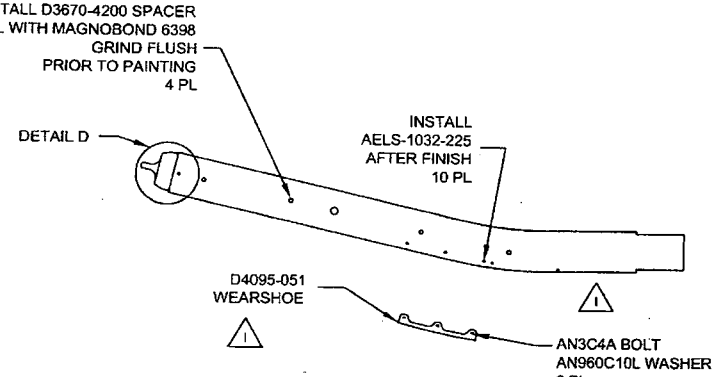

D3391-021 ASSEMBLY DETAIL

D3391-011/-021 FWD TUBE ASSEMBLY PARTS LIST

QTY - 011	QTY - 021	PART NUMBER	DESCRIPTION
X		D3391-011	FWD TUBE ASSEMBLY
	X	D3391-021	FWD TUBE ASSEMBLY
1	1	D3401-041	TOW CAP
9	4	D3670-4200	SPACER
4	4	D3672-1	WASHER
1	1	D4095-051	WEARSHOE
1	1	D6013-047	FWD TUBE
10	10	AN3C4A	BOLT
10	10	AN960C10L	WASHER
10	10	AELS-1032-225	INSERT

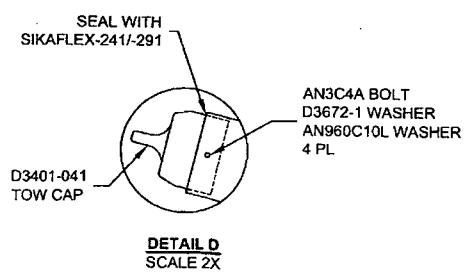

**DETAIL D
SCALE 2X**

RELEASED
2011-11-04

DESIGN	PH	DART AEROSPACE USA, INC	
DRAWN	XDF	KENT, WA	
CHECKED		DRAWING NO.	REV. 1
MFG. APPR.		D3391	SHEET 4 OF 8
APPROVED		TITLE	SCALE
DE APPR.		412 FLOAT SKIDTUBE	NTS
DATE	11.10.13	COPYRIGHT © 2005 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR DISCLOSED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector


Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			


NOTE: Date & initial all entries

25158

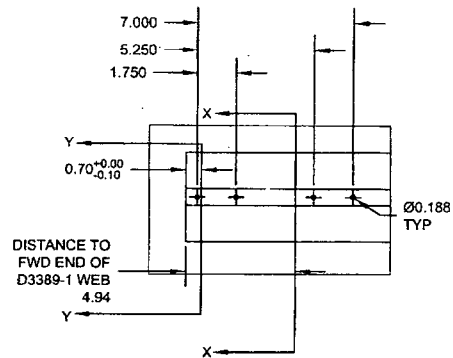


DETAIL J
SCALE 4X

DRILL THRU 21/64" (Ø0.328)
CSINK Ø0.438 X 45° (BOTH SIDES)
12 PL

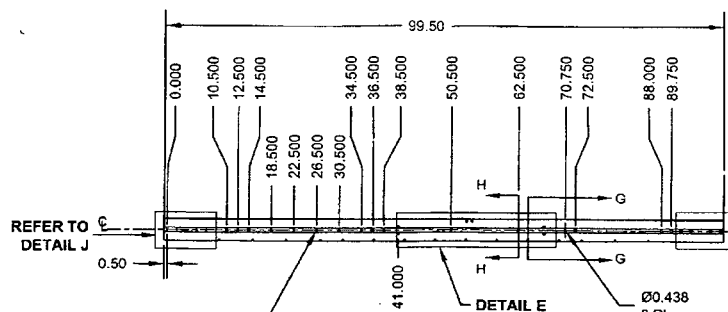


D3391-013 ASSEMBLY DETAIL

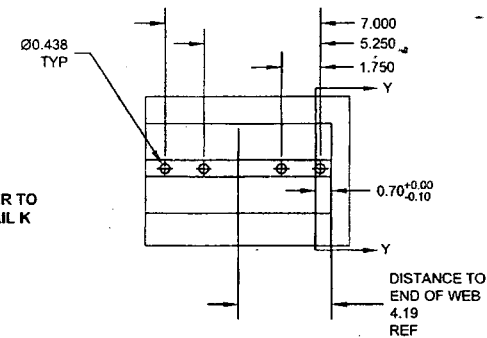


DETAIL K
SCALE 4X




SECTION G-G
SCALE 5X

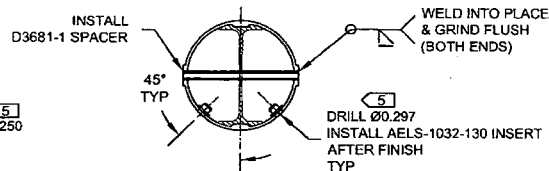

SECTION H-H
SCALE 5X

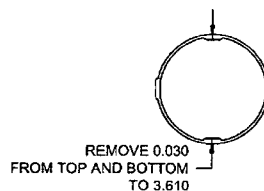

SECTION X-X
SCALE 5X

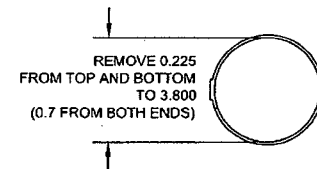


SECTION Y-Y
SCALE 5X

D3391-013 MID TUBE ASSEMBLY PARTS LIST

QTY	PART NUMBER	DESCRIPTION
X	D3391-013	MID TUBE ASSEMBLY
1	D2500-1-100	EXTRUSION
1	D3389-1	WEB
4	D3672-1	WASHER
4	D3672-3	WASHER
12	D3681-1	SPACER
24	AELS-1032-130	INSERT
4	ALS4-428-165	INSERT
4	AN960C10L	WASHER
4	AN960C416L	WASHER
4	MS27039C1-09	SCREW
4	MS27039C4-08	SCREW


D3391-013 MID TUBE ASSEMBLY

- 1) MATERIAL: MAKE FROM D2500-1-100 EXTRUSION
- 2) INSTALL D3389-1 WEB TO OUTER TUBE USING SIKAFLEX-241/291 PER QSI 015
- 3) WELDING: PER DART QSI 004

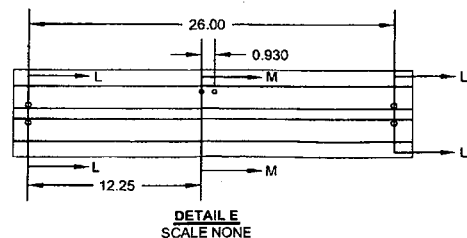


DETAIL E
SCALE NONE

DRILL Ø0.391
INSTALL ALS4-428-165 INSERT
MS27039C4-08 SCREW
D3672-3 WASHER
AN960C416L WASHER
AFTER FINISH
4 PL

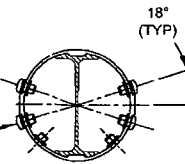


SECTION L-L
SCALE 5X

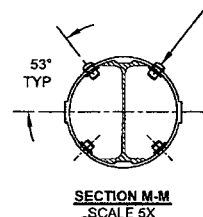

SECTION M-M
SCALE 5X

DRILL Ø0.250
4 PL

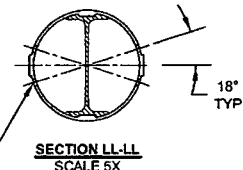

SECTION LL-LL
SCALE 5X

RELEASED
2011-11-04

DESIGN	PH	DART AEROSPACE USA, INC	
DRAWN	XDF	KENT, WA	
CHECKED		DRAWING NO.	REV. I
MFG. APPR.		D3391	SHEET 5 OF 8
APPROVED		TITLE	SCALE
DE APPR.		412 FLOAT SKIDTUBE	NTS
DATE	11.10.13	COPYRIGHT © 2005 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector



Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

85150

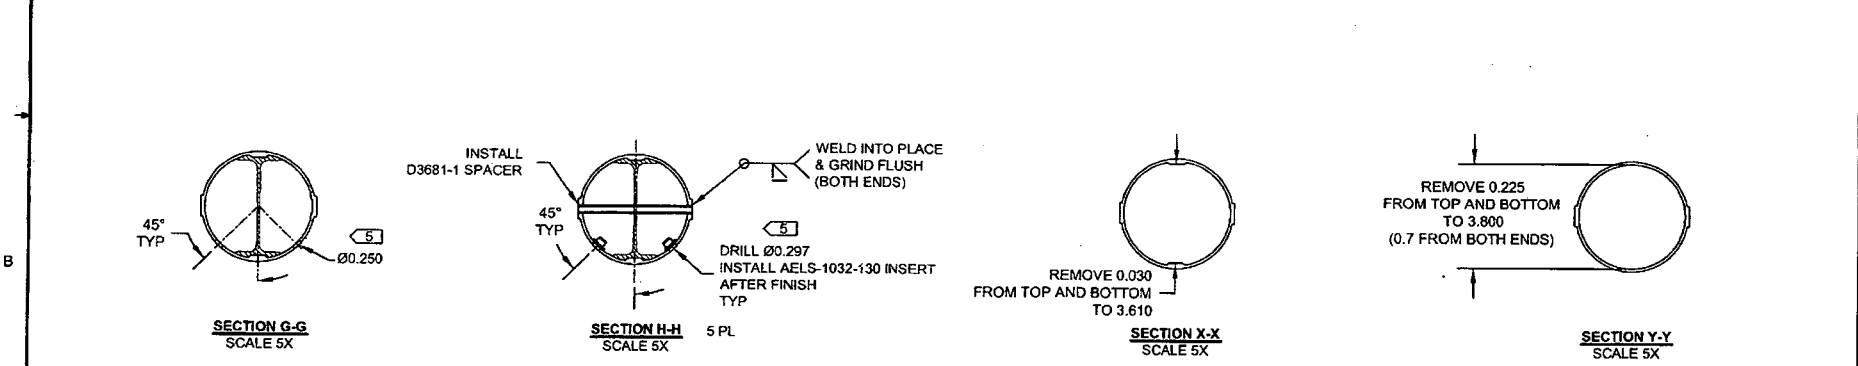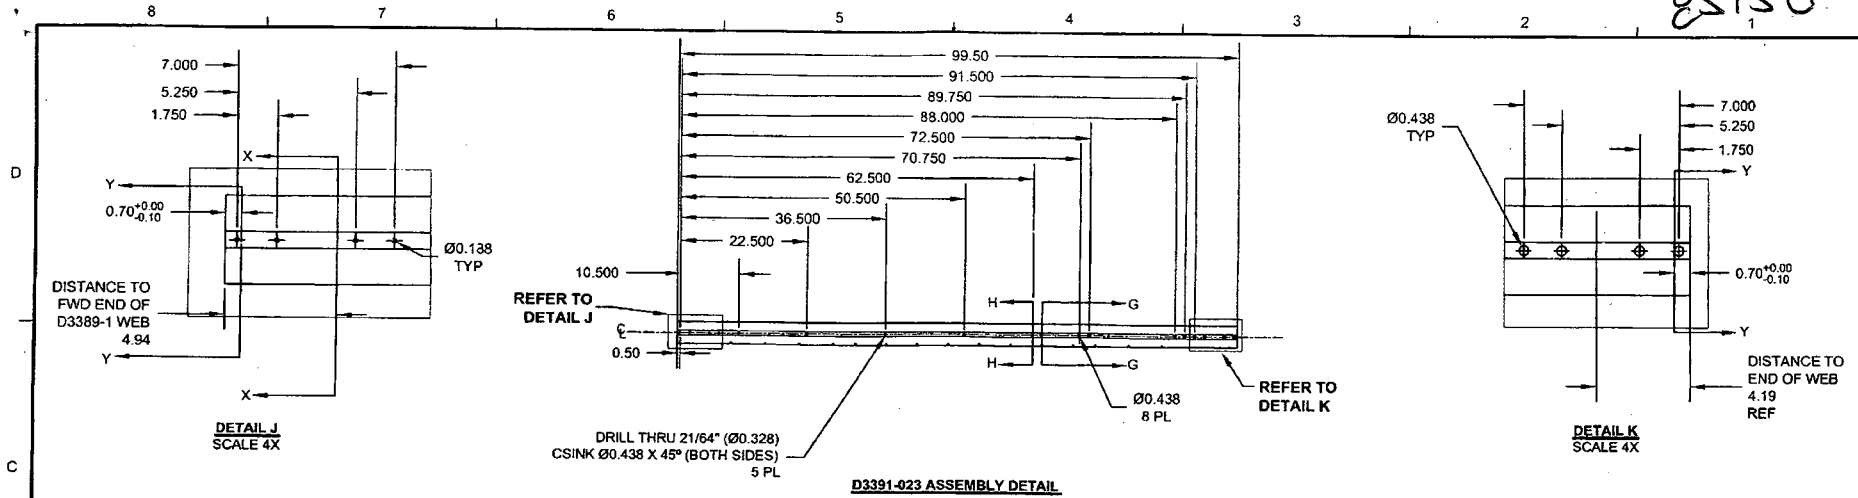

D3391-023 MID TUBE ASSEMBLY PARTS LIST

QTY - 023	PART NUMBER	DESCRIPTION
X	D3391-023	MID TUBE ASSEMBLY
1	D2500-1-100	EXTRUSION
1	D3389-1	WEB
5	D3681-1	SPACER
20	AELS-1032-130	INSERT

D3391-023 MID TUBE ASSEMBLY

- 1) MATERIAL: MAKE FROM D2500-1-100 EXTRUSION
- 2) INSTALL D3389-1 WEB TO OUTER TUBE USING SIKAFLEX-241/291 PER QSI 015
- 3) WELDING: PER DART QSI 004

RELEASED
2011-11-04

DESIGN	PH	DART AEROSPACE USA, INC	
DRAWN	XDF	KENT, WA	
CHECKED		DRAWING NO.	REV. I
MFG. APPR.		D3391	SHEET 6 OF 8
APPROVED		TITLE	SCALE
DE APPR.		412 FLOAT SKIDTUBE	NTS
DATE	11.10.13	COPYRIGHT © 2005 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR LOANED OR REPRODUCED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector


Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____




NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

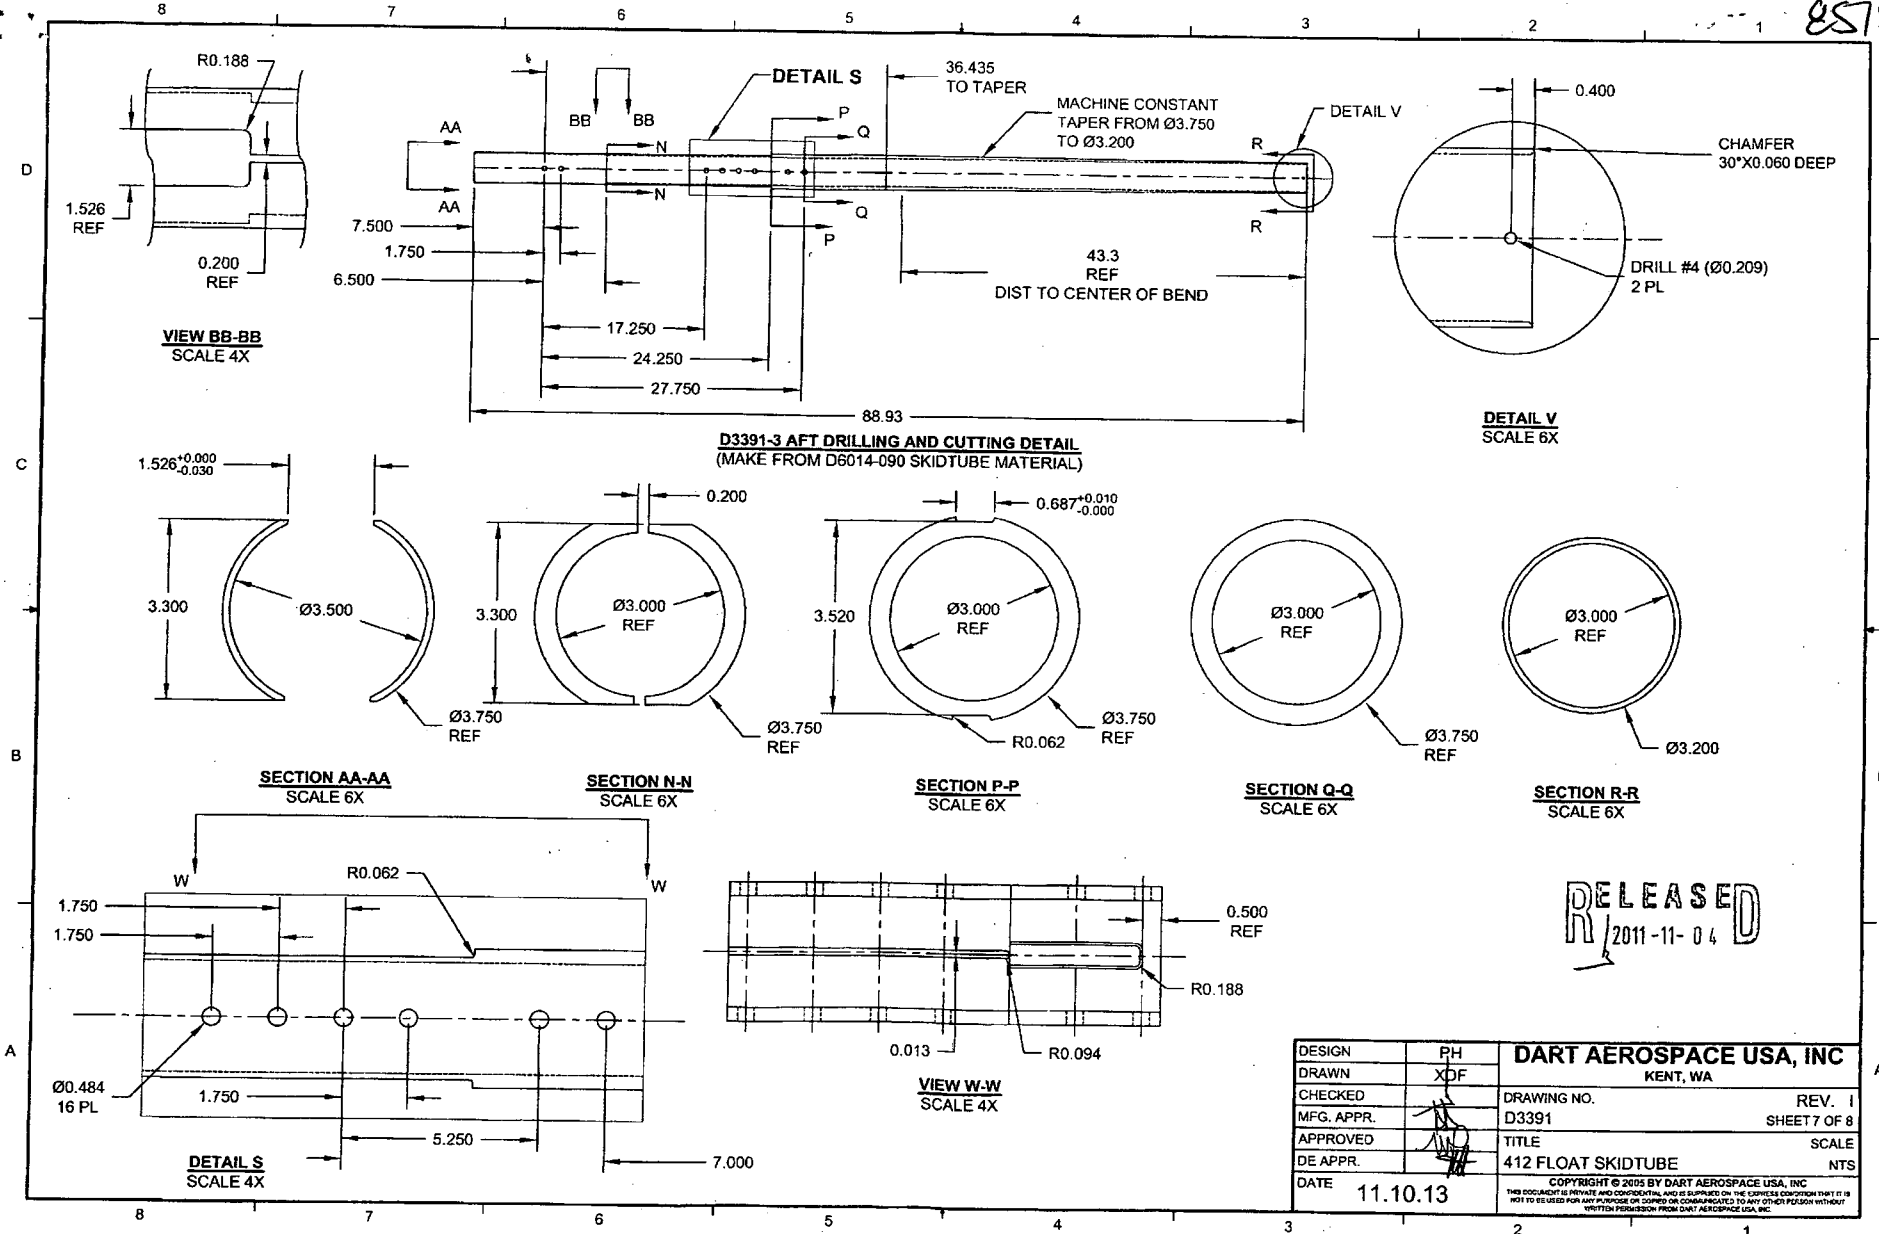85758



RELEASED
2011-11-04

DESIGN	PH	DART AEROSPACE USA, INC	
DRAWN	XDF	KENT, WA	
CHECKED		DRAWING NO.	REV. 1
MFG. APPR.		D3391	SHEET 7 OF 8
APPROVED		TITLE	SCALE
DE APPR.		412 FLOAT SKIDTUBE	NTS
DATE	11.10.13	COPYRIGHT © 2005 BY DART AEROSPACE USA, INC	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR REPRODUCED IN ANY MANNER WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.			

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

NO. 296

AWS D17.1.2001
QUALIFICATION TEST RECORD

Name: B Barclay Elliott
Job number: 85161
Part number: A3391-023
Description: stick
Welding Process: Tig[☒] Mig[]
Base material: Alum
Current: AC[☒] DC[]

TEST REQUIREMENTS AND RESULTS

Visual: pass[☒] fail[]
Penetration: pass[☒] fail[]

UNACCEPTABLE

Cracks: pass[☒] fail[]
Undercut: pass[☒] fail[]
Pin holes: pass[☒] fail[]
Overlap (cold lap): pass[☒] fail[]
Porosity (surface): pass[☒] fail[]
Coloration: pass[☒] fail[]

Qualifier David Taylor Date of Test Coupon 12-06-07
Welder B Barclay Elliott Date of Test Coupon 12-06-07

The above named individual is qualified in accordance with AWS D17.1.2001 to weld